



VEHICLE INSPECTION REPORT

FV14EFX

BMW Z4 20i sDrive M Sport 2dr Auto

nama
GRADE
4

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	10/05/2014	Body Style	Convertible	Last service miles	62,003
Year	2014	Keys	2	MOT Due	16/01/2027
Mileage	62,877 Miles Warranted	Service history	Yes	Gearbox	AUTOMATIC
Fuel Type	Petrol	Service documents	Printout	Gears	8
Colour	RED	Number of stamps	6		
VIN	WBALL32080J082828	Last service date	07/01/2026		

Last service 07/01/2026 at 62003 miles (6 services (1 main dealer). Eml light is on
 Car been scanned and detected:
 P12B8 generally indicates a plausibility error with the Ambient Pressure Sensor

Tyres

NSF
NSR
OSF
OSR
Spare

Features


- Bluetooth connection
- Rear parking sensor
- Electric door mirrors
- Front head restraints
- Metallic Paint
- Central locking
- Front parking sensor
- Steering wheel mounted controls
- Air conditioning
- Height adjustable drivers seat
- ABS
- Remote central locking
- Heated front seat
- Radio/CD
- Front armrest
- Steering wheel rake adjustment
- Drivers airbag
- Leather seat trim
- PAS
- Body coloured bumpers
- Front electric windows
- Steering wheel reach adjustment
- Passenger airbag
- Alloy wheels

Photos





Condition Check

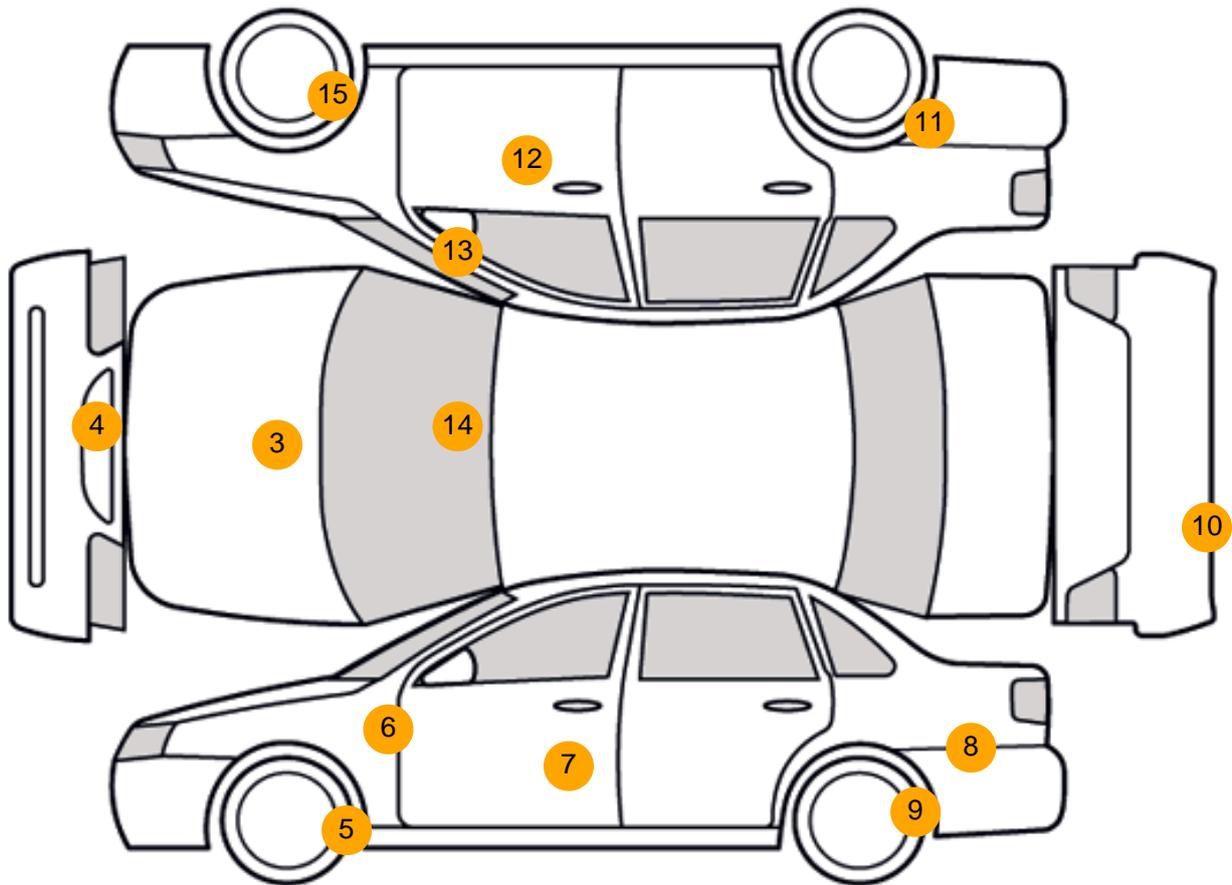

Damage Photos



1: Seat Back Cover osf
Scuffed
Over 25mm



2: Seat Back Cover nsf
Scuffed
Over 25mm



3: Bonnet
Chipped
Multiple Chips



4: Bumper Front
Poor Previous Repair
Paint Flake



5: Wheel nsf
Scratched
Over 50mm



6: Wing nsf
Scratched
Over 25mm Thru Paint



7: Door nsf
Scratched
UpTo 25mm Thru Paint



8: Qtr Panel nsr
Scratched
Over 25mm Thru Paint



9: Wheel nsr
Scratched
Over 50mm



10: Bumper Rear
Poor Previous Repair
Paint Flake



11: Wheel osr
Scratched
Over 50mm



12: Door osf
Chipped
Edge Chip



13: Door Mirror Assy osf
Scratched (Painted)
Over 25mm Thru Paint



14: Screen Front
Chipped
UpTo 10mm



15: Wheel of
Scratched
Up To 50mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	Fault	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Roof / sunroof	OK	Radio	OK
Windows	OK	Steering	OK