



VEHICLE INSPECTION REPORT

GU59RFY

Fiat 500 1.2 Pop 3dr

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 Present

nama
GRADE
3

Details

Reg. date 09/09/2009

Year 2009

Mileage 55,644 Miles
Warranted

Fuel Type Petrol

Colour RED

VIN ZFA31200000341947

Body Style Hatchback

Keys 2

Service history Yes

Service documents Service Book

Number of stamps 7

Last service date 01/10/2018

Last service miles 38,081

MOT Due 02/09/2025

CAP Clean £1,500.00

CAP Average £1,100.00

CAP Below £700.00

Gearbox MANUAL

Gears 5

Doors 3

Last Service: 01/10/2018 at 38081 miles. (7 services (2 main dealer)) Squeaking noise from engine

Tyres

NSF BUDGET 3.0mm

NSR BUDGET 2.0mm

OSF BUDGET Worn

OSR BUDGET 3.0mm

Spare

Features


- PAS
- Electric door mirrors
- Front head restraints
- Passenger airbag
- Steel wheels
- Rear wiper
- Air conditioning
- Solid Paint
- Central locking
- Radio/CD
- Climate control
- ABS
- Remote central locking
- Body coloured bumpers
- Front electric windows
- Drivers airbag
- Cloth seat trim

Photos





Condition Check

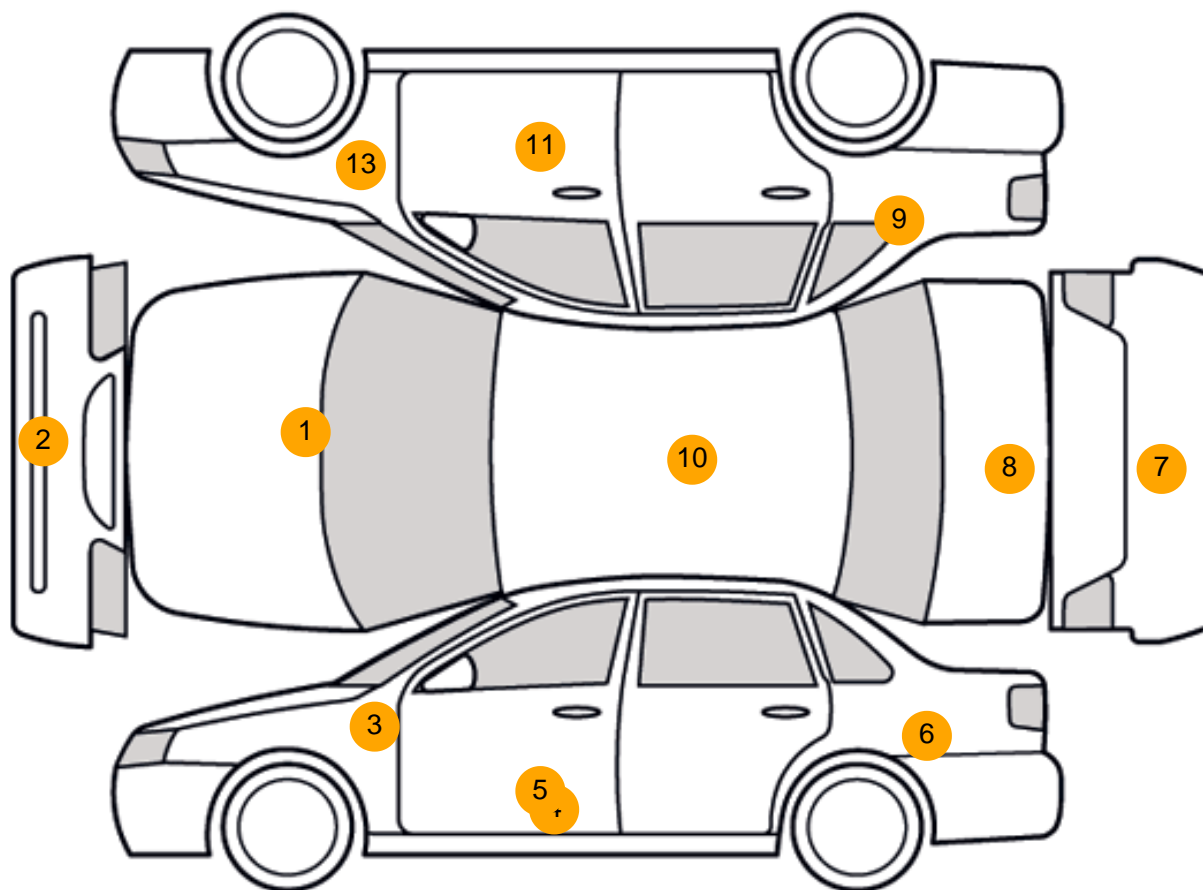

Damage Photos



1: Bonnet
Poor Previous Repair
Paint Flake



2: Bumper Front
Chipped
Multiple Chips



3: Wing nsf
Chipped
1 To 5



4: Door nsf
Dented
Over 2 UpTo 10mm



5: Door Moulding nsf
Scratched (Painted)
Over 25mm Thru Paint



6: Qtr Panel nsr
Chipped
1 To 5



7: Bumper Rear
Poor Previous Repair
Paint Flake



8: Boot Lid
Poor Previous Repair
Paint Flake



9: Qtr Panel osr
Chipped
1 To 5



10: Roof
Poor Previous Repair
Paint Flake




11: Door Moulding osf
Scratched (Painted)
UpTo 25mm Thru Paint



12: Door osf
Scratched
Over 25mm Not Thru Paint



13: Wing osf
Chipped
1 To 5

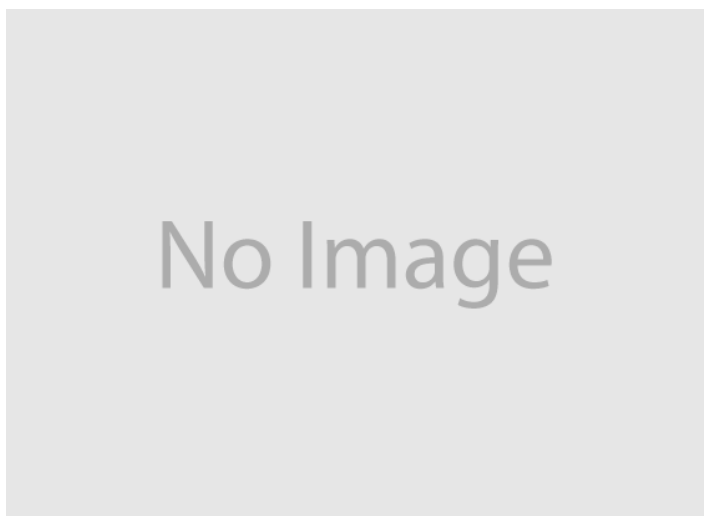

14: Tyre osf
Worn
Replace

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK