



# VEHICLE INSPECTION REPORT

**WO65NWC**

## Jeep Renegade 2.0 Multijet Limited 5dr 4WD Auto

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Buyer To Apply

nama  
GRADE  
**4**

### Details

Reg. date	29/01/2016	Colour	BLUE	Service history	None
Year	2016	VIN	1C4BU0000GPC88799	MOT Due	02/03/2027
Mileage	61,260 Miles Warranted	Body Style	Estate	Gearbox	AUTOMATIC
Fuel Type	Diesel	Keys	1	Gears	9

NO V5

No service history Noisy engine

Nsr door pad missing and nsr window does not work

### Tyres

NSF	BUDGET	6.0mm
NSR	BUDGET	6.0mm
OSF	BRIDGESTONE	6.0mm
OSR	BUDGET	6.0mm
Spare		

## Features


- Bluetooth connection
- Rear parking sensor
- Body coloured bumpers
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking
- Cruise control
- Rear wiper
- Electric door mirrors
- Front armrest
- Metallic Paint
- Traction control
- Leather seat trim
- Heated front seat
- Telephone
- Towbar
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels
- Navigation system
- Radio/CD
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking

## Photos





## Condition Check

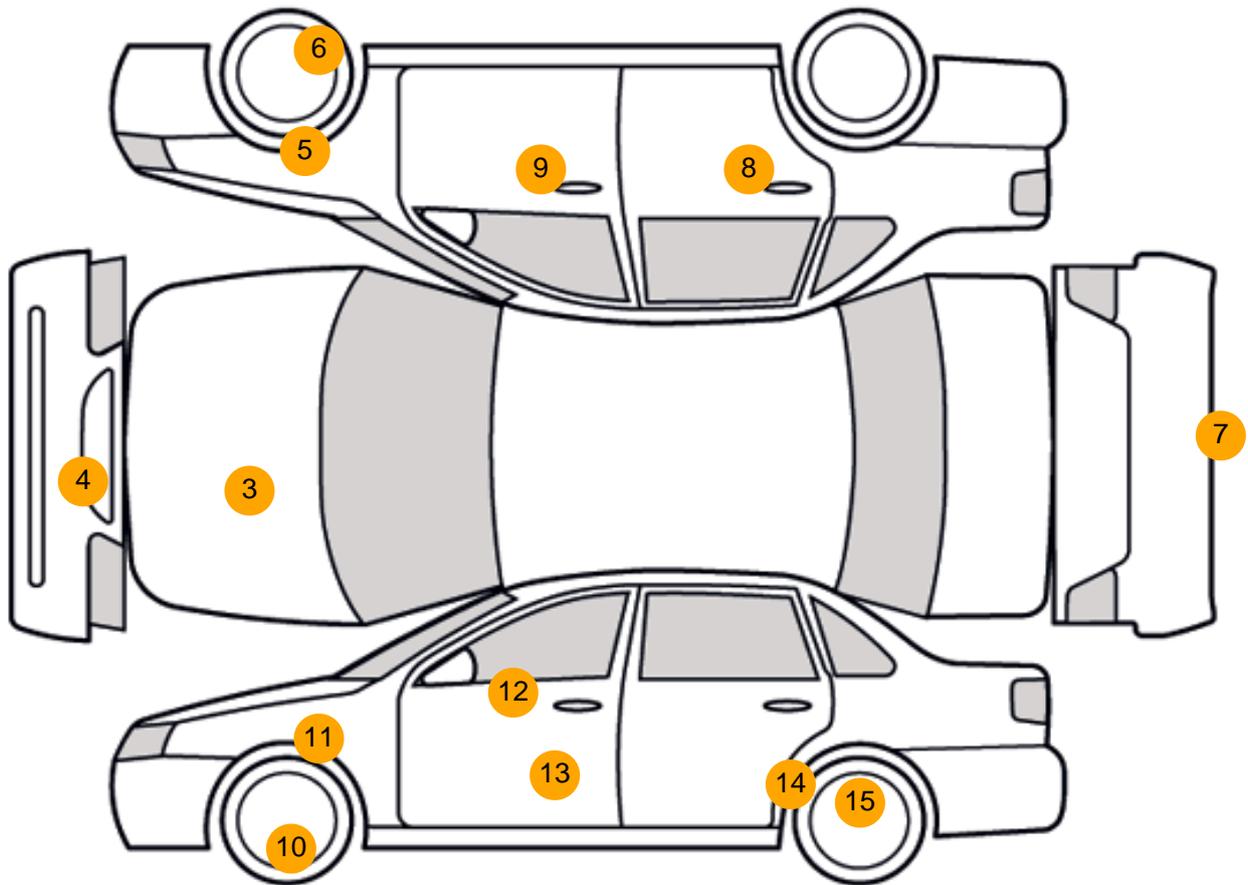


## Damage Photos



1: Door Pad nsr  
Missing  
Replace



2: Carpets Front  
Holed  
UpTo 3mm

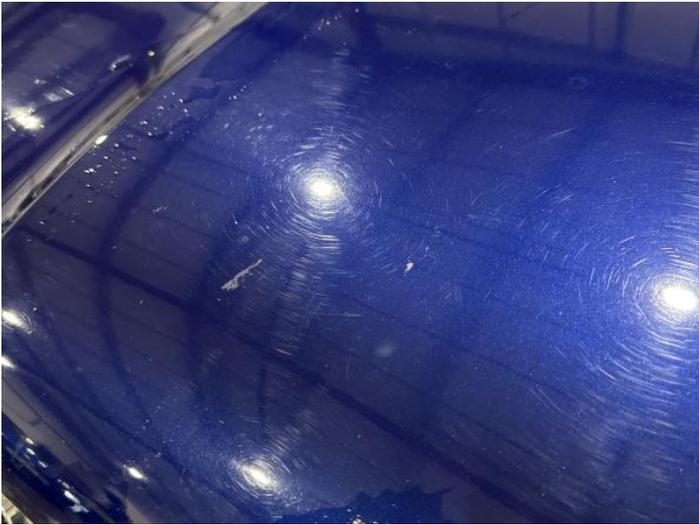

3: Bonnet  
Chipped  
Multiple Chips



4: Bumper Front  
Chipped  
1 To 5



5: Wing osf  
Chipped  
Multiple Chips



6: Wheel osf  
Scratched  
Up To 50mm



7: Bumper Rear  
Scratched  
25 to 100mm Thru Paint



8: Door osr  
Scratched  
Over 25mm Thru Paint



9: Door osf  
Scratched  
Over 25mm Thru Paint



10: Wheel nsf  
Scratched  
Over 50mm



11: Wing osf  
Chipped  
Multiple Chips



12: Door nsf  
Scratched  
Over 25mm Thru Paint



13: Door nsf  
Scratched  
Over 25mm Thru Paint



14: Door nsr  
Dented  
With Paint Damage



15: Wheel nsr  
Corroded  
Light



16: Switches And Controls  
Broken  
Replace

### Interior

**Carpet Condition** Average  
**Seat Condition** Average

**Upholstery Condition** Average  
**Odour** No

## Vehicle Inspection Report

### Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	Fault	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	Fault	Radio	OK
Sat nav	OK	Steering	OK