



VEHICLE INSPECTION REPORT

YK65WTY

Mercedes-Benz A Class A220 CDI AMG Sport 5dr Auto

nama
 GRADE
3

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	29/09/2015	Body Style	Hatchback	Last service miles	93,852
Year	2015	Keys	1	MOT Due	05/10/2026
Mileage	100,000 Miles Warranted	Service history	Yes	Gearbox	AUTOMATIC
Fuel Type	Diesel	Service documents	Printout	Gears	7
Colour	BLUE	Number of stamps	9	Doors	5
VIN	WDD1760032V104572	Last service date	17/04/2025		

Last Service -17.04.2025 at 93852 miles (9 services)

Tyres


NSF	CONTINENTAL	Damaged
NSR	CONTINENTAL	5.0mm
OSF	CONTINENTAL	Damaged
OSR	CONTINENTAL	5.0mm
Spare		

Features


- Bluetooth connection
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking
- Alloy wheels
- Cruise control
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking
- Navigation system
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Leather seat trim

Photos



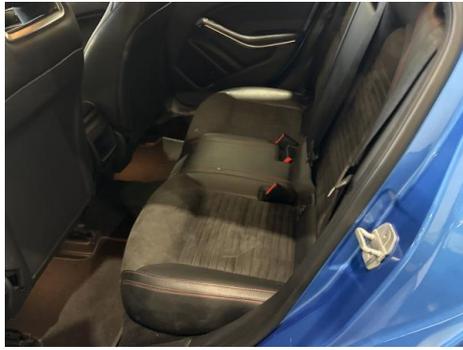

Condition Check

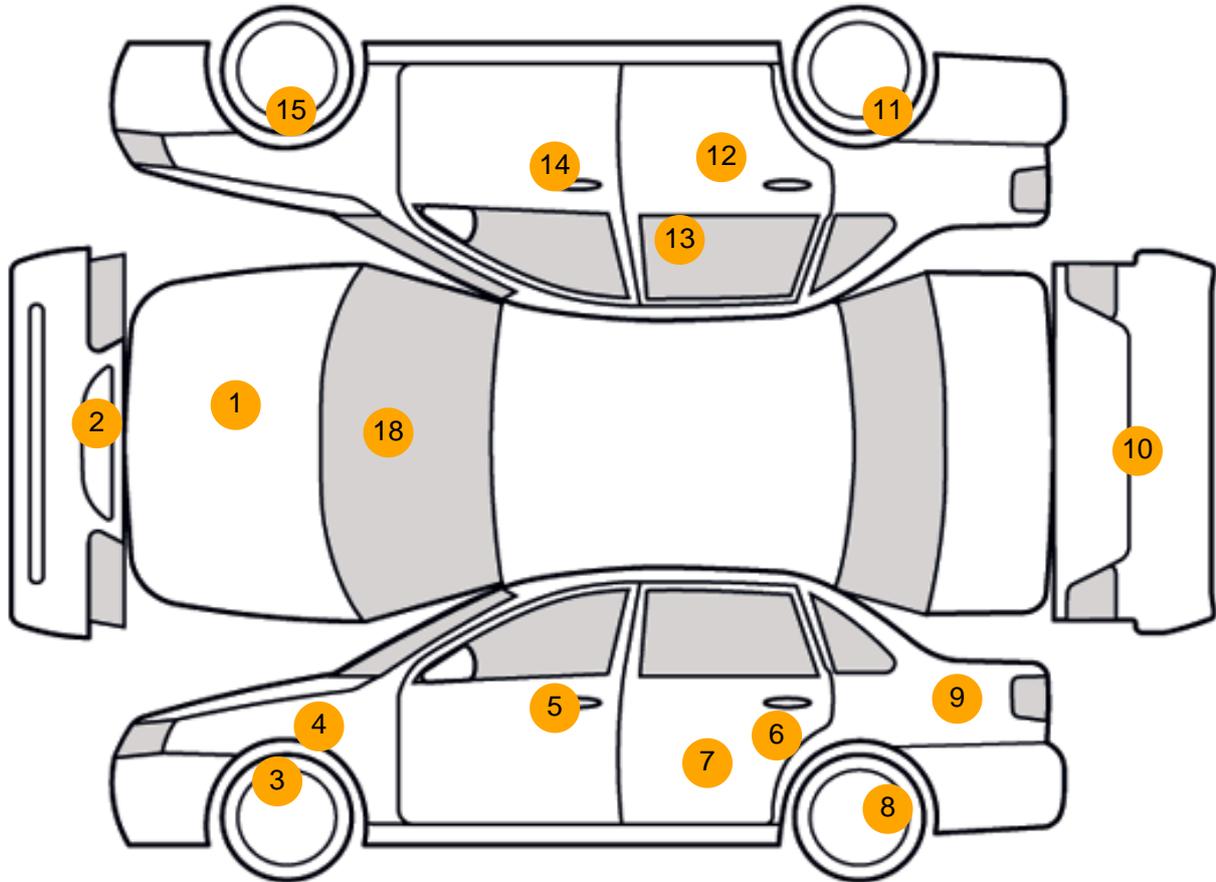

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front
Chipped
Multiple Chips



3: Wheel nsf
Scratched
Over 50mm



4: Wing nsf
Chipped
1 To 5



5: Door nsf
Chipped
1 To 5



6: Door nsr
Dented
Between 10mm + 30mm



7: Door nsr
Scratched
Over 25mm Thru Paint



8: Wheel nsr
Scratched
Over 50mm



9: Qtr Panel nsr
Dented
With Paint Damage



10: Bumper Rear
Scratched
25 to 100mm Thru Paint



11: Wheel osr
Scratched
Over 50mm



12: Door osr
Dented
Between 10mm + 30mm



13: Door osr
Chipped
1 To 5



14: Door osf
Chipped
Edge Chip



15: Wheel of
Scratched
Over 50mm



16: Tyre of
Missing
Replace



17: Tyre of
Damaged
Replace



18: Screen Front
Chipped
Up To 10mm

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK