

VEHICLE INSPECTION REPORT

YF15LFY

Skoda Yeti 1.2 TSI SE 5dr

nama
 GRADE
5

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	31/05/2015	Body Style	Hatchback	Last service miles	61,952
Year	2015	Keys	2	MOT Due	30/01/2027
Mileage	62,633 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Petrol	Service documents	Printout	Gears	6
Colour	SILVER	Number of stamps	9	Doors	5
VIN	TMBKF75L1F6055923	Last service date	19/01/2026		

Last Service - 19.01.2026 at 61952 miles (9 services) Hoist in the boot

Tyres

NSF	BUDGET	4.0mm
NSR	FALKEN	5.0mm
OSF	FIRESTONE	5.0mm
OSR	FALKEN	5.0mm
Spare		

Features


- Bluetooth connection
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking
- Cruise control
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels

Photos





Condition Check

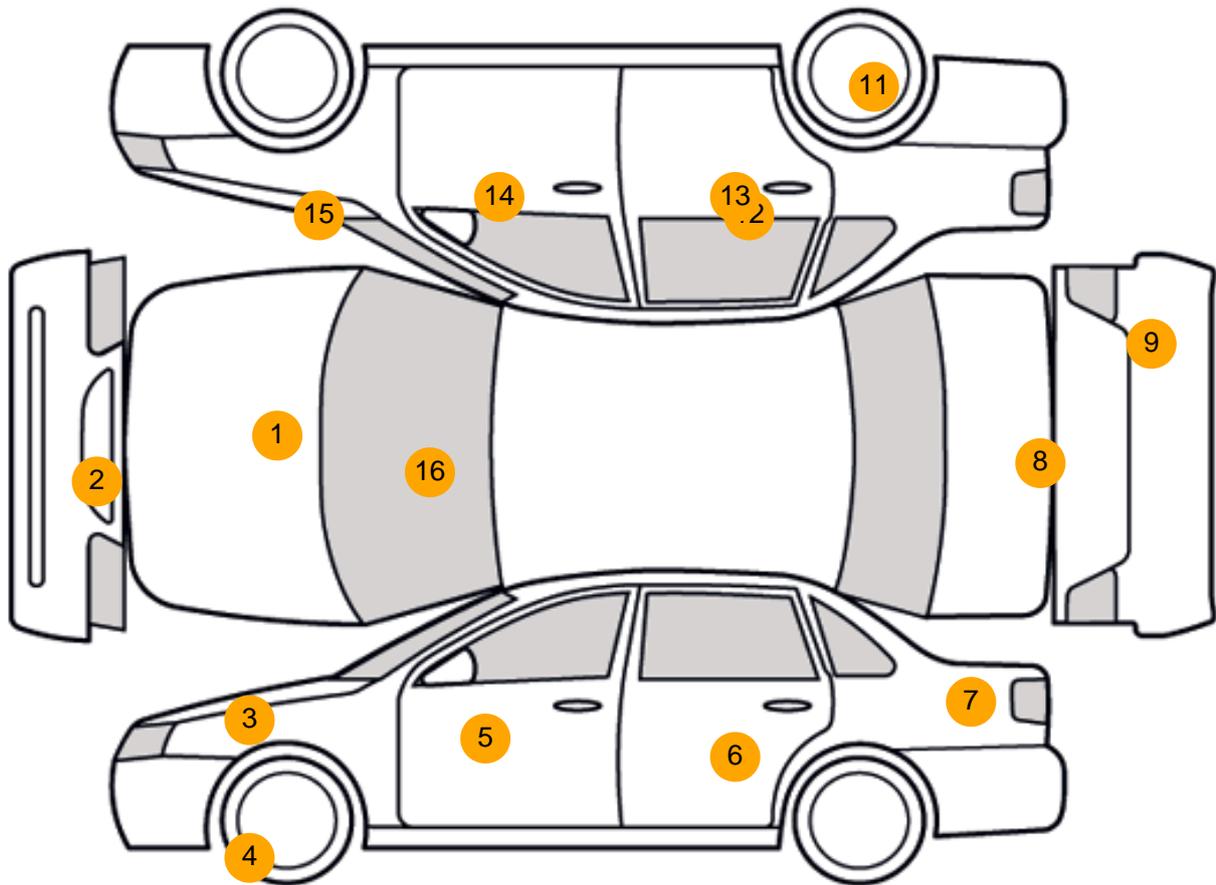

Damage Photos



1: Bonnet
Chipped
1 To 5



2: Bumper Front
Dented
With Paint Damage



3: Wing nsf
Scratched
Over 25mm Thru Paint



4: Wheel nsf
Scratched
Over 50mm



5: Door nsf
Scratched
Over 25mm Thru Paint



6: Door nsr
Scratched
Over 25mm Thru Paint



7: Qtr Panel nsr
Chipped
1 To 5



8: Tailgate
Dented
Over 30mm



9: Bumper Rear
Scratched
25 to 100mm Thru Paint



10: Qtr Panel osr
Scratched
Over 25mm Thru Paint



11: Wheel osr
Scratched
Up To 50mm



12: Door osr
Dented
Between 10mm + 30mm



13: Door osr
Scratched
Over 25mm Thru Paint



14: Door osf
Dented
With Paint Damage



15: Wing osf
Cracked
Replace



16: Screen Front
Chipped
Over 10mm

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK