



VEHICLE INSPECTION REPORT

HD15EPN

Audi A3 S3 TFSI Quattro 5dr S Tronic

nama
 GRADE
2

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	30/07/2015	Body Style	Hatchback	Last service miles	66,198
Year	2015	Keys	2	MOT Due	05/08/2026
Mileage	82,167 Miles Warranted	Service history	Yes	Gearbox	SEMI AUTO
Fuel Type	Petrol	Service documents	Printout	Gears	6
Colour	WHITE	Number of stamps	8	Doors	5
VIN	WAUZZZ8V6GA005819	Last service date	11/07/2024		

Last Service - 11.07.2024 at 66198 miles (8 services)

Tyres

NSF	CONTINENTAL	5.0mm
NSR	CONTINENTAL	3.0mm
OSF	CONTINENTAL	5.0mm
OSR	CONTINENTAL	3.0mm

Spare

Features


- Bluetooth connection
- Navigation system
- Steering wheel mounted controls
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Passenger airbag
- Leather seat trim
- Cruise control
- PAS
- Digital radio
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Curtain airbags
- Side airbags
- Alloy wheels
- Front parking sensor
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Rear electric windows
- Metallic Paint
- Drivers airbag
- Central locking
- Heated front seat
- Rear wiper
- Electric door mirrors
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Remote central locking

Photos





Condition Check

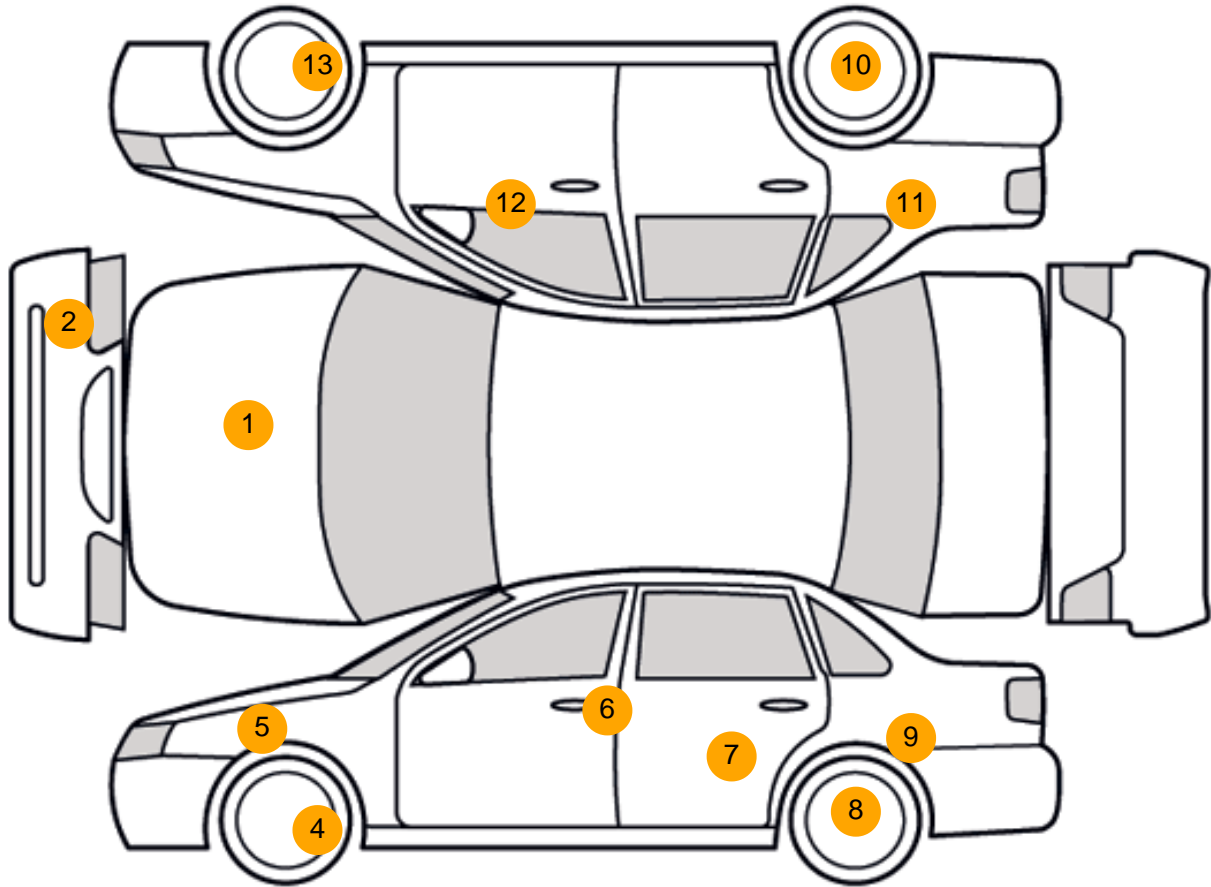

Damage Photos



1: Bonnet
Chipped
1 To 5



2: Bumper Front
Scratched
25 to 100mm Thru Paint



3: Bumper Front
Insecure
Action Required



4: Wheel nsf
Scratched
Over 50mm



5: Wing nsf
Chipped
1 To 5



6: Handle Outer nsf
Scratched (Painted)
Up To 25mm Thru Paint



7: Door nsr
Dented
Between 10mm + 30mm



8: Wheel nsr
Scratched
Over 50mm



9: Qtr Panel nsr
Dented
Between 10mm + 30mm



10: Wheel nsr
Corroded
Light



11: Qtr Panel osr
Chipped
1 To 5



12: Door osf
Chipped
1 To 5



13: Wheel osf
Scratched
Over 50mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Poor
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK