



VEHICLE INSPECTION REPORT

YE18XLZ

BMW 5 Series 520d M Sport 4dr Auto

nama
 GRADE
3

| Inspection | | Vehicle | |
|-----------------|----|---------|---------|
| Serious Damage? | No | VAT | Margin |
| | | V5 | Present |

Details

| | | | | | |
|-----------|----------------------------|-------------------|------------|--------------------|------------|
| Reg. date | 21/05/2018 | Body Style | Saloon | Last service miles | 87,025 |
| Year | 2018 | Keys | 1 | MOT Due | 18/09/2026 |
| Mileage | 102,248 Miles Warranted | Service history | Yes | Gearbox | AUTOMATIC |
| Fuel Type | Diesel | Service documents | Printout | Gears | 8 |
| Colour | WHITE | Number of stamps | 4 | Doors | 4 |
| VIN | WBAJC32060WE58469 | Last service date | 22/05/2025 | | |

£90 ADDITIONAL FEE.

Last service 22/05/2025 at 87,025 miles- 4 services. Print Eml light is on
 Car been plugged in and detect
 Particulate Matter (PM) Sensor Temperature Circuit Fault
 Bank 1 Sensor 2 oxygen sensor is stuck lean
 Reductant Injection Air Pump Control Circuit Low
 Key got missing buttons

Tyres

| | | |
|-----|----------|---------|
| NSF | LANDSAIL | 3.0mm |
| NSR | PIRELLI | 2.0mm |
| OSF | LANDSAIL | 4.0mm |
| OSR | GOODRIDE | Illegal |

Spare

Features


- Bluetooth connection
- Navigation system
- Service indicator
- Body coloured bumpers
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Curtain airbags
- Rear airbags
- Remote central locking
- Cruise control
- Park assist camera
- Steering wheel mounted controls
- Electric door mirrors
- Front armrest
- Rear electric windows
- Metallic Paint
- Drivers airbag
- Side airbags
- Leather seat trim
- Front parking sensor
- PAS
- Digital radio
- Front fog lights
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Tyre pressure monitor
- Alloy wheels
- Heated front seat
- Rear parking sensor
- Radio/CD
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Passenger airbag
- Central locking

Photos





Condition Check

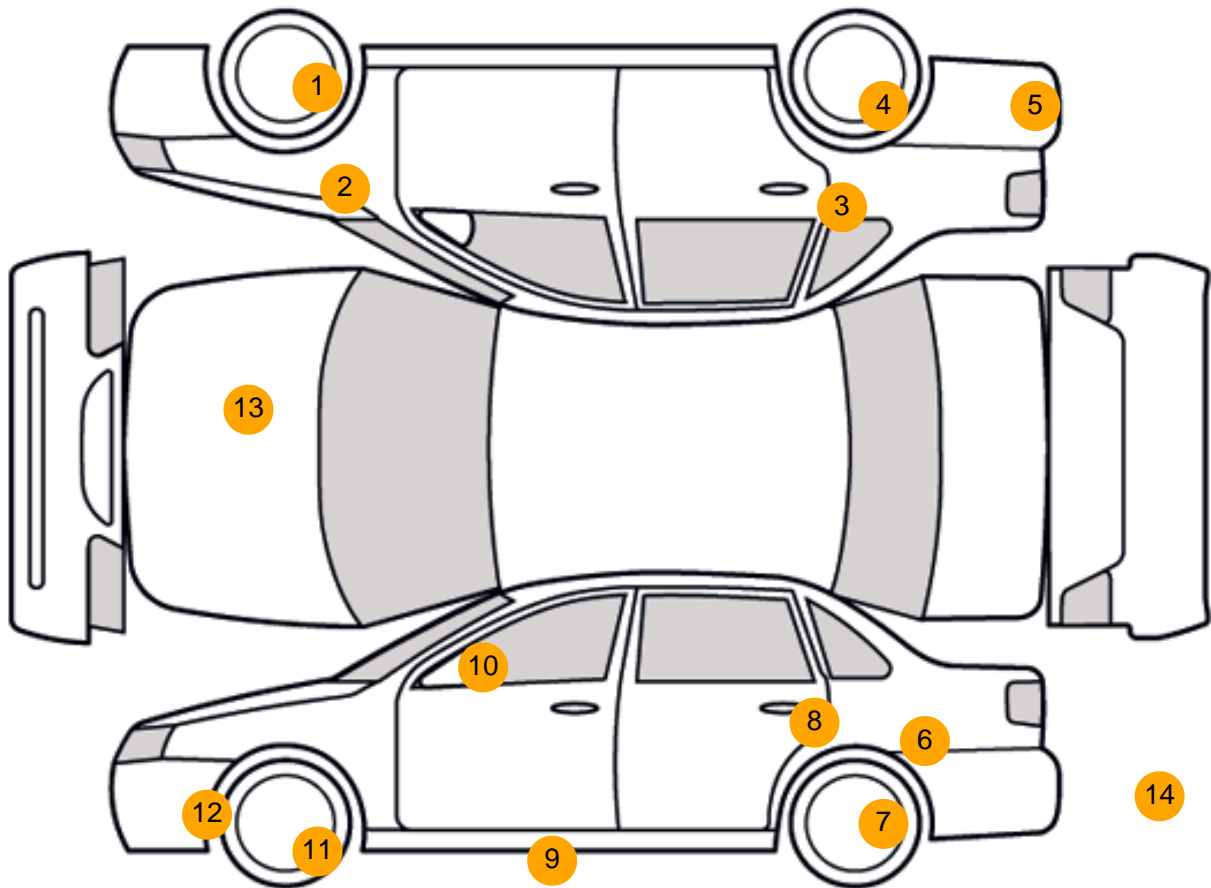

Damage Photos



1: Wheel of
Scratched
Over 50mm



2: Wing of
Chipped
1 To 5



3: Qtr Panel osr
Dented
2 Or Less UpTo 10mm



4: Wheel osr
Scratched
Over 50mm



5: Bumper Rear
Poor Previous Repair
Paint Flake



6: Qtr Panel nsr
Dented
With Paint Damage



7: Wheel nsr
Scratched
Over 50mm



8: Door nsr
Chipped
Edge Chip



9: Sill Panel Trim ns
Scratched (Painted)
Over 25mm Thru Paint



10: Door Mirror Assy nsf
Scratched (Painted)
Over 25mm Not Thru Paint



11: Wheel nsf
Scratched
Over 50mm



12: Bumper Front
Scratched
Over 100mm Thru Paint



13: Bonnet
Scratched
UpTo 25mm Not Thru Paint



14: Bumper Rear Moulding
Scratched (Painted)
Over 25mm Thru Paint



15: Door Pad osr
Scuffed
Over 25mm



16: Door Pad nsr
Scuffed
Over 25mm



17: Fascia Trim
Missing
Replace

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

| | | | |
|---------------|----|--|----|
| Engine Runs | OK | Gearbox 1st and Reverse Test | OK |
| Brakes | OK | Gearbox Static Gear Selection (engine running) | OK |
| Parking Brake | OK | No Excessive Smoking | OK |

| | | | |
|--------------------------|-------|-------------------------------------|----|
| EML light illuminated | Fault | Oil warning light illuminated | OK |
| Airbag light illuminated | OK | DPF light illuminated | OK |
| ABS light illuminated | OK | Service indicator light illuminated | OK |
| Windows | OK | Radio | OK |
| Sat nav | OK | Steering | OK |