



VEHICLE INSPECTION REPORT

YX16NJF

Mini Hatchback 1.5 Cooper 3dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
4

Details

Reg. date	01/03/2016	Body Style	Hatchback	Last service miles	74,040
Year	2016	Keys	2	MOT Due	16/02/2027
Mileage	85,989 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Petrol	Service documents	Printout	Gears	6
Colour	GREY	Number of stamps	5	Doors	3
VIN	WMWXM520502C55485	Last service date	28/11/2024		

£90 ADDITIONAL FEE.

Last service 28/11/2024 at 74,040 miles- 5 services. Recorded on on-board system and printout Car revving by itself

Abs light coming on

Lights flashing suspected electric problems

Bonnet will not open

Tyres

NSF	MAXTREK	4.0mm
NSR	MAXTREK	5.0mm
OSF	MAXTREK	4.0mm
OSR	MAXTREK	5.0mm
Spare		

Features


- Bluetooth connection
- Steering wheel mounted controls
- Air conditioning
- Height adjustable drivers seat
- Solid Paint
- Isofix child seat anchor points
- Remote central locking
- Cruise control
- Digital radio
- Folding rear seats
- Rear headrests
- 3x3 point rear seat belts
- Passenger airbag
- Partial leather seat trim
- PAS
- Body coloured bumpers
- Front electric windows
- Steering wheel rake adjustment
- ABS
- Side airbags
- Alloy wheels
- Rear wiper
- Electric door mirrors
- Front head restraints
- Steering wheel reach adjustment
- Drivers airbag
- Central locking

Photos





Condition Check

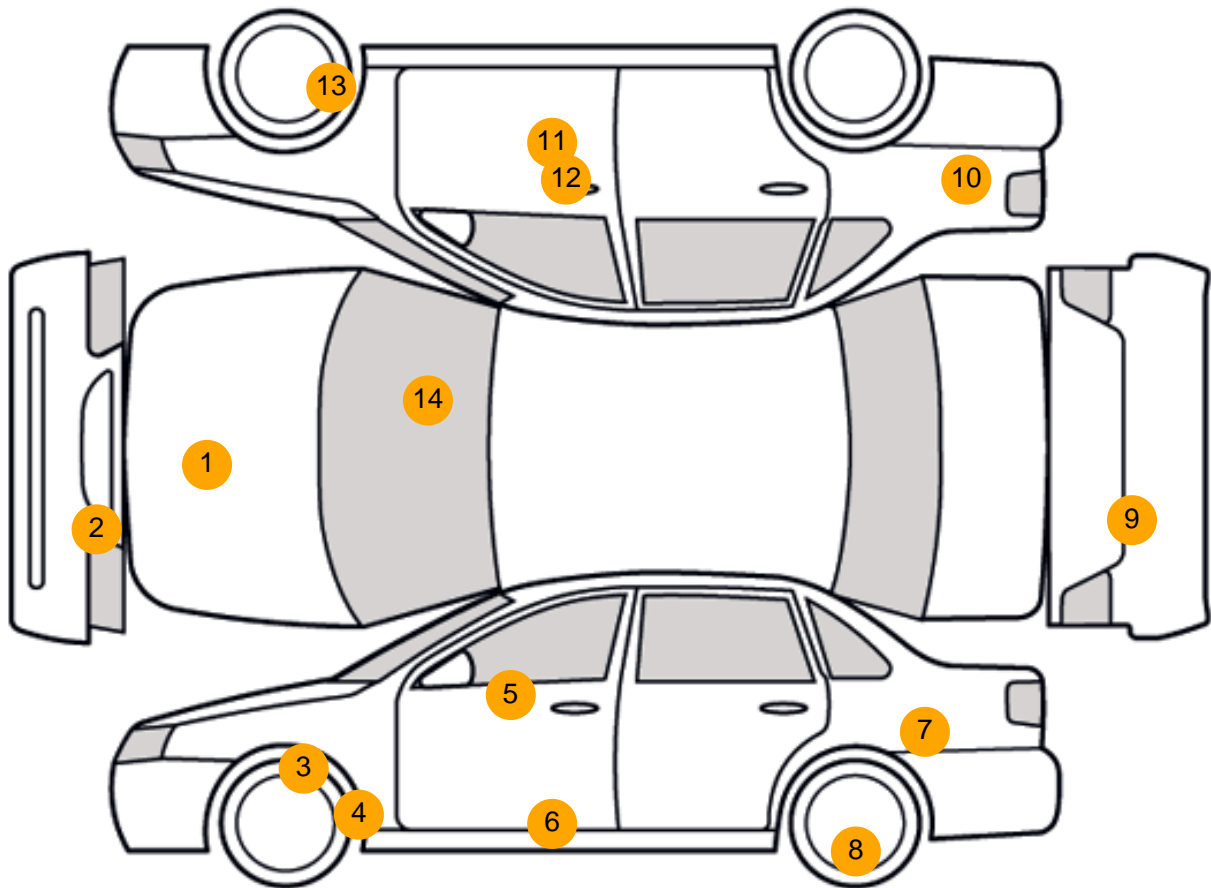

Damage Photos



1: Bonnet
Scratched
Over 25mm Thru Paint



2: Bumper Front
Scratched
25 to 100mm Thru Paint



3: Wheel nsf
Scratched
Over 50mm



4: Wing Front Arch Extension ns
Scuffed (Unpainted)
Over 100mm



5: Door Mirror Assy nsf
Broken
Replace



6: Door nsf
Scratched
Over 25mm Thru Paint



7: Qtr Panel nsr
Dented
With Paint Damage



8: Wheel nsr
Scratched
Over 50mm



9: Bumper Rear
Dented
With Paint Damage



10: Qtr Panel osr
Dented
With Paint Damage



11: Door osf
Chipped
Edge Chip



12: Handle Outer osf
Broken
Replace



13: Wheel osf
Scratched
Over 50mm



14: Screen Front
Cracked
Replace



15: Seat Back Cover of sf
Scuffed
Over 25mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	Fault	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	Fault		
Windows	OK	Radio	OK
		Steering	OK