



VEHICLE INSPECTION REPORT

SO15FBZ

Citroen Berlingo Multispace 1.6 HDi 90 XTR 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
4

Details

Reg. date	26/08/2015	Body Style	MPV	Last service miles	43,654
Year	2015	Keys	2	MOT Due	20/12/2026
Mileage	68,189 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Diesel	Service documents	Service Book	Gears	5
Colour	SILVER	Number of stamps	7		
VIN	VF77J9HP0FJ649177	Last service date	16/12/2022		

£100 ADDITIONAL FEE

Last service 16/12/2022 at 43,654 miles- 7 services (4 main dealer) Multiple panels need machine polish
 VAW converted to van rear seats missing
 Service spanner displayed

Tyres

NSF	BUDGET	Illegal
NSR	BUDGET	4.0mm
OSF	BUDGET	Illegal
OSR	NEXEN	4.0mm
Spare		

Features


- Bluetooth connection
- Radio/CD
- Roof rails
- Steering wheel rake adjustment
- Drivers airbag
- Remote central locking
- PAS
- Body coloured bumpers
- Air conditioning
- Steering wheel reach adjustment
- Passenger airbag
- Cloth seat trim
- Rear parking sensor
- Electric door mirrors
- Front electric windows
- Metallic Paint
- Side airbags
- Alloy wheels
- Rear wiper
- Front fog lights
- Height adjustable drivers seat
- ABS
- Central locking

Photos





Condition Check

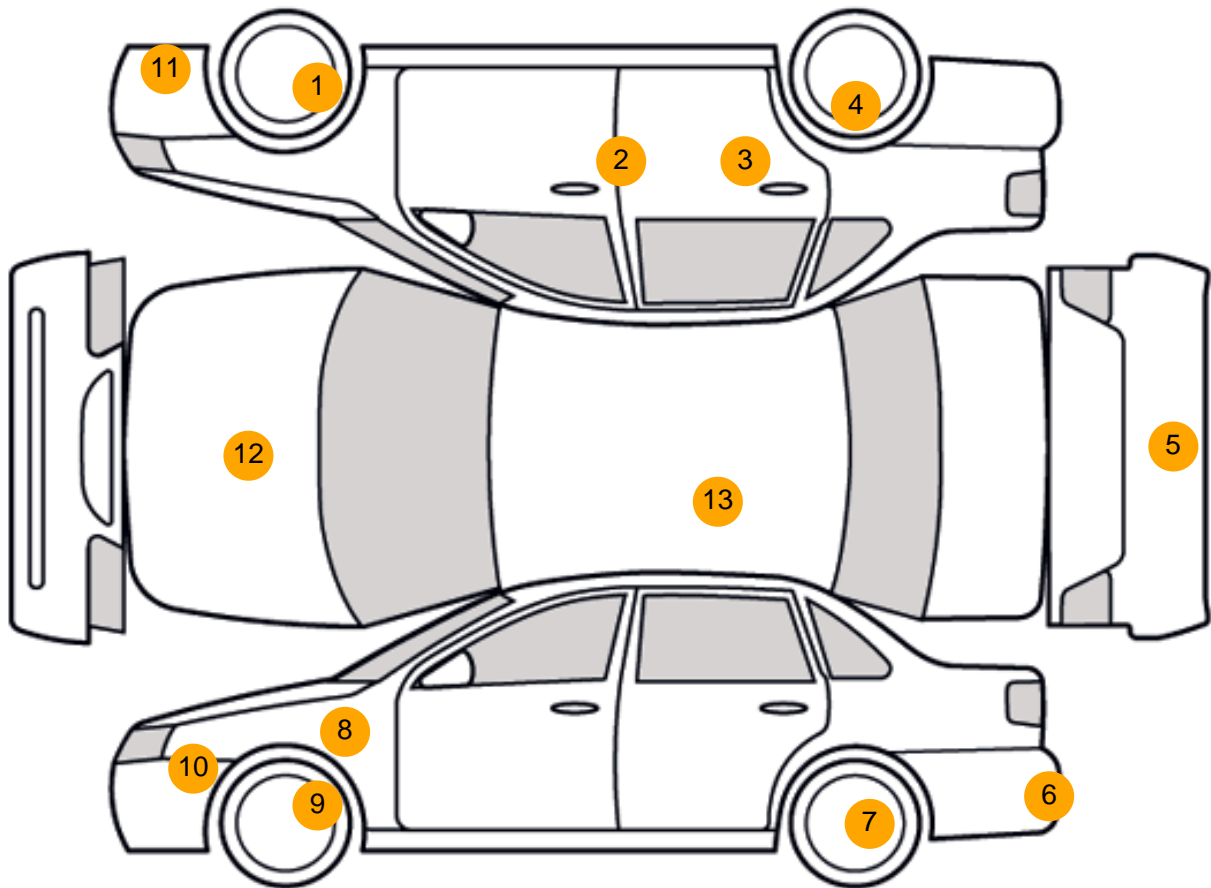

Damage Photos



1: Wheel osf
Scratched
Over 50mm



2: Door osf
Chipped
Edge Chip



3: Door osr
Chipped
1 To 5



4: Wheel osr
Scratched
Over 50mm



5: Tailgate
Dented
Over 30mm



6: Bumper Rear
Scratched
25 to 100mm Thru Paint



7: Wheel nsr
Scratched
Over 50mm



8: Wing nsf
Dented
Over 30mm



9: Wheel nsf
Scratched
Over 50mm



10: Headlamp ns
Broken
Replace



11: Bumper Front
Scratched
Over 100mm Thru Paint



12: Bonnet
Poor Previous Repair
Paint Flake



13: Roof
Dented
Over 30mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	Fault
Windows	OK	Radio	OK
		Steering	OK