



VEHICLE INSPECTION REPORT

LF69LKD

Volkswagen T-Cross 1.0 TSI SE 5dr

nama
 GRADE
3

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	07/09/2019	Body Style	Hatchback	Last service miles	58,348
Year	2019	Keys	2	MOT Due	19/04/2027
Mileage	75,351 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Petrol	Service documents	Printout	Gears	5
Colour	GREY	Number of stamps	6	Doors	5
VIN	WVGZZZC1ZLY003484	Last service date	12/04/2024		

£100 ADDITIONAL FEE.

Last service 12/04/2024 at 58348 miles (6 services (4 main dealer). Some panel require machine polish

Service due message displayed

Intermittent clutch fault

Tyres



NSF	BUDGET	6.0mm
NSR	RAPID	5.0mm
OSF	ROYALBLACK	5.0mm
OSR	RAPID	5.0mm
Spare		

Features


- Bluetooth connection
- Rear wiper
- Body coloured bumpers
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Side airbags
- Alloy wheels
- Cruise control
- Service indicator
- Electric door mirrors
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Drivers airbag
- Central locking
- Front parking sensor
- Steering wheel mounted controls
- Front fog lights
- Front armrest
- Rear electric windows
- Solid Paint
- Isofix child seat anchor points
- Remote central locking
- PAS
- Digital radio
- Roof rails
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Passenger airbag
- Cloth seat trim

Photos



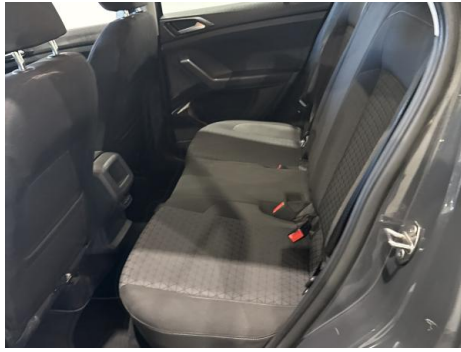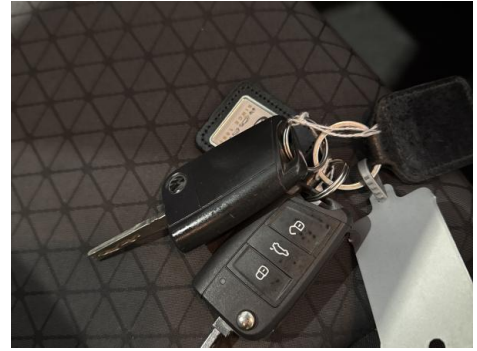

Condition Check

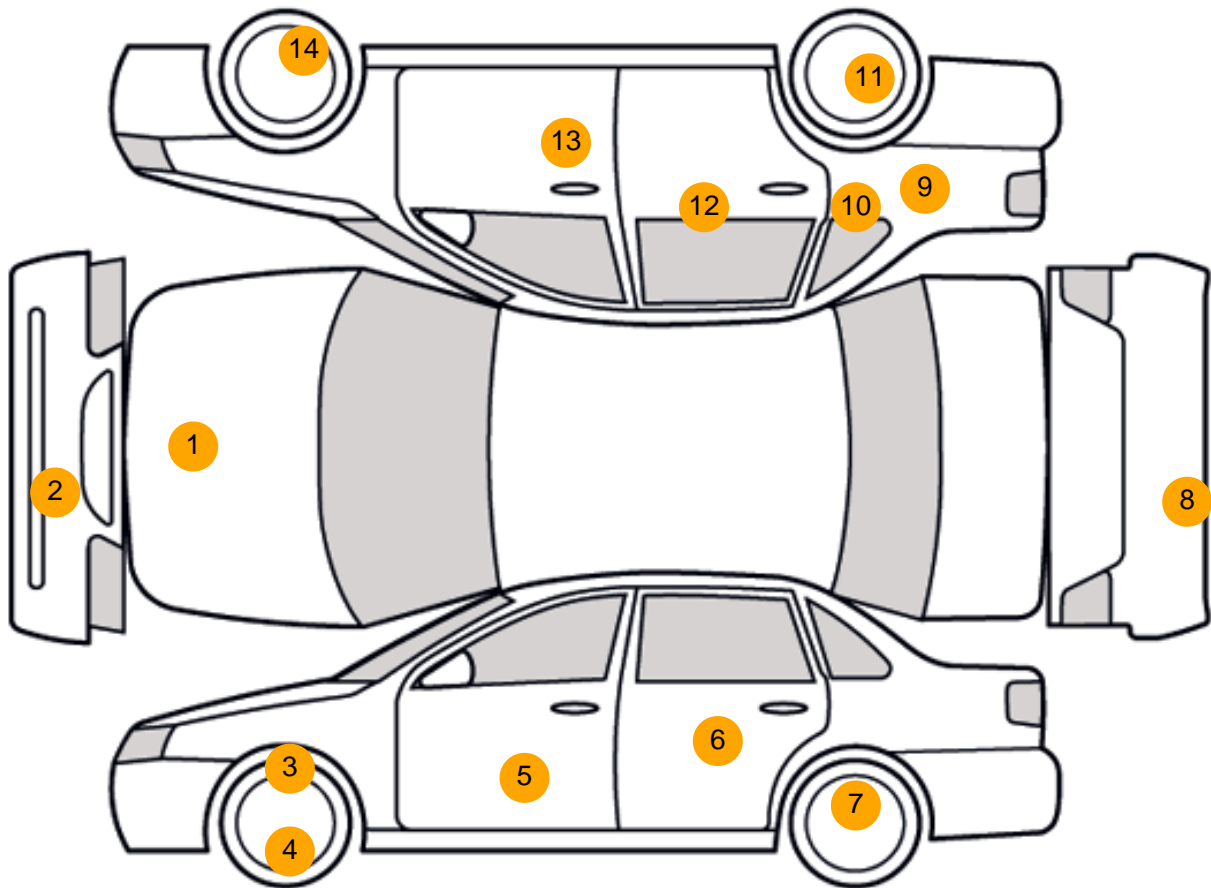

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front
Scratched
25 to 100mm Thru Paint



3: Wing nsf
Dented
Between 10mm + 30mm



4: Wheel nsf
Scratched
Over 50mm



5: Door nsf
Dented
With Paint Damage



6: Door nsr
Chipped
1 To 5



7: Wheel nsr
Scratched
Over 50mm



8: Bumper Rear
Scratched
25 to 100mm Thru Paint



9: Qtr Panel Moulding os
Scuffed (Unpainted)
UpTo 100mm



10: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint



11: Wheel osr
Scratched
Over 50mm



12: Door osr
Scratched
Over 25mm Thru Paint



13: Door osf
Chipped
Multiple Chips



14: Wheel osf
Scratched
Up To 50mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	Fault
Brakes	OK	Clutch Slip Test from Static	Fault
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	Fault
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	Fault
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK